

Kestrel Hood & Exhaust Cleaning

418 Foundry Ave, Suite 2, Ridgeline, CO 80014
License IKECA CECS-4417
(555) 402-8815

HT-2026-0047

Serviced Jul 1, 2026

Certificate of Kitchen Exhaust System Cleaning

SERVICE LOCATION

Maple & Rye Kitchen
305 Distillery Row

HOOD SYSTEM

Main kitchen hood
90-day cleaning interval

This certifies that the kitchen exhaust system identified above was cleaned on Jul 1, 2026 in accordance with NFPA 96 (2024 edition), the Standard for Ventilation Control and Fire Protection of Commercial Cooking Operations.

The system is maintained on a 90-day cleaning interval set by the servicing contractor; the next service is due by Sep 29, 2026.

SCOPE OF WORK

Hood, duct riser, and fan cleaned to bare metal. Polished stainless. Replaced 2 baffle filters.

SERVICE DETAIL BY AREA

Area	Result	Grease depth	Notes
Hood interior	Cleaned	1,800 µm	Polished to bare stainless
Filters	Cleaned	-	2 baffle filters replaced
Duct, vertical run	Cleaned	2,300 µm (at cleaning trigger)	-
Duct, horizontal run	Inaccessible	-	No service access within 12 ft of run
Exhaust fan	Cleaned	900 µm	-

Grease depth measured in microns; NFPA 96 sets the cleaning trigger at 2,000 µm.

AREAS NOT CLEANED

- Duct, horizontal run: inaccessible (No service access within 12 ft of run)
- Horizontal duct run: no service access within 12 ft of the run.

CLEANING REPORT DETAILS

Accessible areas not cleaned

None.

Duct access panel locations

Vertical riser at 6 ft and 14 ft above the hood collar.

Visible duct leakage

None observed.

Leaking access panels

None observed.

DEFICIENCIES NOTED

Access panel needed (needs attention): Horizontal duct run has no service access; panel installation recommended


Deficiencies are conditions observed during service that need the owner's attention; they are not corrected by cleaning.

POST-SERVICE CHECKS

Exhaust fan operational: yes · Access panels secured: yes · Pilot lights relit: yes

Photo evidence on file: 2 before, 2 after. Photo records are retained by the contractor and available on request.

PHOTO EVIDENCE

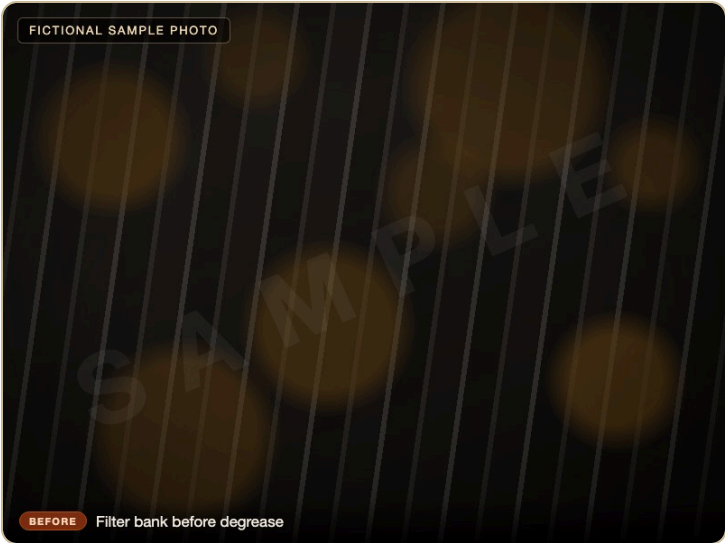

Before: Filter bank before degrease



Before: Duct riser at the access panel



After: Plenum cleaned to bare metal



After: Filters re-hung after polish

Technician: M. Ortega

M. Ortega

NFPA 96 compliance attested by M. Ortega, recorded Jul 1, 2026 at 10:30 PM UTC

Date: Jul 1, 2026